


Coaxial Terminations, 1 and 2 Point Direct PCB **BBAI-1203**

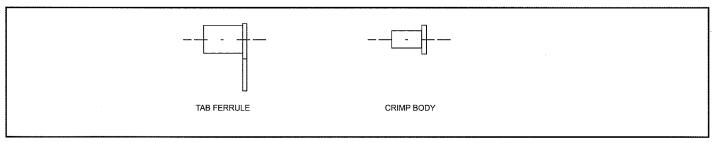





Trim cable to dimensions shown being careful not to nick or damage braids or center conductor. Trim center conductor. * These dimensions suit 2,54 (.100) and 7,62 (.300) PCB pitches, for other pitches see Note 4.

STEP 2







STEP 3



STEP 4

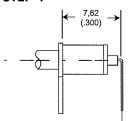

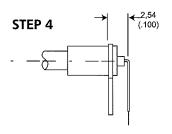

Slide Tab-Ferrule over cable.

NOTE: Orientation of tab-ferrule is optional depending upon mounting requirements. Flare braids and slide crimp body over cable dielectric until braids meet flange on crimp body.

Slide tab-ferrule over braids to face of flange and crimp using Cannon's Crimp Tool and suitable Die Set (see table).

Cable Numbers	Die Size	Die Set	
RG174/U	3,25 (.128)	K29263	
RG178/U	2,67 (.105)	K29263	
RG179/U	3,25 (.128)	K29263	
RG188/U	3,25 (.128)	K29263	
RG196/U	2,67 (.105)	K29263	
RG316/U	3,25 (.128)	K29263	

Bend center conductor to dimension shown depending upon preferred orientation. These dimensions suit 2,54 (.100) and 7,62 (.300) PCB pitches. For other pitches of 2,54 (.100) multiples add 2,54 (.100) multiples to the 12,70 (.500) and 6,35 (.250) dimensions in the cable stripping instructions Note 1.

Cannon



Dimensions are shown: mm (inch) Specifications and dimensions subject to change